

## 

1. REMOVE AND REPLACE EXISTING WINDOWS ON THE BASE OPERATIONS SIDE OF HANGAR ONE, BLDG 433. INSTALL NEW CUSTOM WINDOW SERIES 8300 FP WINDOWS TO MATCH ORIGINAL CONSTRUCTION AS CLOSE AS POSSIBLE. 2. REMOVE EXISTING BRICK, FRAMING & SIDING TO ENLARGE WINDOW OPENINGS TO ITS ORIGINAL SIZE AS NECESSARY. REPAIR INTERIOR/EXTERIOR FINISHES TO MATCH EXISTING.

1/8

GENERAL NOTES:


4. INTERIOR WINDOW TRIM SHALL BE STAINED OASIS OAO2. DV LOUNGE INTERIOR WOOD TRIM SHALL MATCH EXISTING TRIM. 3. WINDOW GLAZING SHALL BE LAMINATED AND A MINIMUM OF  $1/4^{\text{\tiny I}}$  THICK TO MEET FORCE PROTECTION STANDARDS.

5. RESTROOM DOOR AND FRAME SHALL BE RELOCATED TO FOR INSTALLATION OF NEW WINDOW. RELOCATE EXISTING PIPE IN SOFFIT; CASE THE OPENING WITH WOOD STAINED TO MATCH EXISTING.

6. EXISTING WOOD HANDRAIL IN BASE OPS FIRST LANDING SHOULD BE CONNECTED AT THE SOUTHEAST CORNER WHERE THE EXISTING HANDRAIL TERMINATES AT THE NEW WINDOW OPENING. 7. IN SECOND FLOOR ADMINISTRATIVE AREA, BOX OUT WIRES AND CONDUIT AT FOUR WINDOW JAMBS. PATCH WALLS AS REQUIRED REUSING EXISTING WALL PANELS.

 $\bigcirc$ 

50

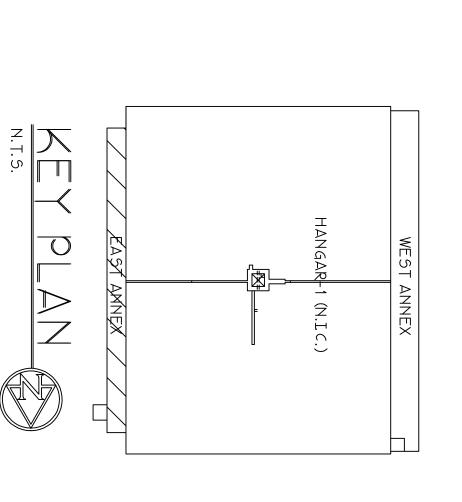

DI D	3401	Commence	EXISTI				9		
¥	SASTR CONTRACTOR	<b>₹</b>	EXISTING ELEVATION			2	DATE	16 SEP 03	JUL 05
DATE VE CONCINCIO	S75TH CES SAUCK OFFICE	GNORTH	TION	BUILDING 433, HANGAR	BASE OPS WINDOWS	CHUGACH MANAGEMENI SERVICES, INC P.O. BOX 25499 560 E. 34TH AVENUE, SUITE 105 SCOTT AFB, IL 62225 ANCHORAGE, AK 99503-4196 (618) 744-9613 (907) 563-8866	DECORTION	35% DESIGN DRAWING	A5BUILT5
(4)	375TH CONSMICK	ATTONO		VGAR I	OWS	SEO E. 34TH AVENUE, SUTE 105 ANCHORAGE, AK. 99503-4196 (907) 563-6866			
91	EQX.						DRAMM	DLW	DLW
							ATTRO		

PROJECT NO. DO#5253 VDYD 03-0308